

Title: O-Ring Installation And Flange Assembly Procedure

O-RING INSTALLATION AND FLANGE ASSEMBLY PROCEDURE

FOR

LIGO VACUUM EQUIPMENT

Hanford, Washington
and
Livingston, Louisiana

PREPARED BY:

MANUFACTURING
QUALITY ASSURANCE:

TECHNICAL DIRECTOR:

PROJECT MANAGER:

S. Maturo
Philip F. Finkel
Gene S. ...
D. A. Williams
Robert Bayly

Information contained in this specification and its attachments is proprietary in nature and shall be kept confidential. It shall be used only as required to respond to the specification requirements, and shall not be disclosed to any other party.

REV	LTR.	BY-DATE	APPD. DATE	DESCRIPTION OF CHANGE

Q SW 10/29 R23 11/7/96 Released per DEO 0336

PROCESS SYSTEMS INTERNATIONAL, INC. SPECIFICATION

INITIAL APPROVALS	PREPARED DATE	APPROVED DATE	Number	Rev.
	SW 10/29/96	R23 11/7/96	V049-2-169	φ
			LIGO-E970172-0-V	Page 1 of 2

Title

O-RING INSTALLATION AND FLANGE ASSEMBLY PROCEDURE

1.0 PURPOSE

This procedure controls the final installation of viton o-rings and flanges on vacuum equipment.

2.0 GENERAL

Installation of the o-rings should be done in class 100 clean room areas. Handling and assembly should be done wearing the appropriate clean room protective clothing and clean gloves. The vessel receiving the o-rings should be clean and dry.

The o-ring grooves and mating flat face flange should be inspected for local contamination including dirt, water, metal chips, detergent or washing process residue etc.

Spot Cleaning

Spot cleaning of small local dirty areas (such as the bottom of the o-ring groove) may be done using lint free wipers and isopropyl alcohol or a CO₂ cleaning gun.

Vacuum Baked O-Rings

Each size flange has two o-ring grooves. Each groove has a specific o-ring(PSI part number)designed for an exact fit. These part numbers are referenced in O-Ring Spec. V049-2-045.

The o-rings that are to be used for final flange assembly must be vacuum baked (by PSI) to remove volatile compounds prior to installation. Before installing the o-ring, the assembler must verify that the o-ring has been vacuum baked by PSI. The o-ring package will state that the o-ring is baked. O-rings will be given a different part number after baking.

3.0 RESPONSIBILITIES

The manufacturing group and site contractors are responsible for installation of o-rings and flanges.

PSI Q.A. is responsible for monitoring that procedures are being followed.

4.0 PROCEDURE

4.1 O-ring Installation

Due to the large flange diameters, three people are required to hold the o-ring in position during installation. The o-rings are easily inserted into the groove by starting at the top and working down. They fit snugly on their ID and are held in place by the groove dovetail. Care should be taken not to roll or twist the o-ring during installation.

Number
Rev.

SPECIFICATION

Number	V049-2-169	Rev.
A		0

Title

**O-RING INSTALLATION AND FLANGE ASSEMBLY
PROCEDURE**

4.2 Mating Flange Installation

After the o-rings are installed, the mating flange is carefully positioned parallel to the o-ring flange. A centering pin is used in one bolt hole to align the flange for bolting. The bolts are inserted with a washer under the head and under the nut. All bolts should be installed hand tight. The mating flange should be in contact with the o-rings but not compressing the o-rings. After contact with the o-rings is made, it is important not to move the mating flange to preclude rolling or twisting the o-ring.

4.3 Torqueing the Flange

Bolt tightening for 7/8 in. bolts is to be done in a cross-flange "star" pattern. The recommended final torque value is 220 ft-lbs. The bolts should be torqued in ~25% increments:

Torque %	25%	50%	75%	100%
	55 ft-lbs	110 ft-lbs	165 ft-lbs	220 ft-lbs

The last step in the bolt tightening procedure is a final torque check done in a sequential fashion going around the flange. The cross-flange "star" pattern is not required for the final torque check.

4.4 Tagging

After the final torque check has been done, the assembled flanged joint should be tagged with a label indicating the date of assembly, final torque value, and assembler's signature. The metal tag shall be attached to a flange bolt using stainless steel wire.

Number

Rev.

SPECIFICATION

Number	A	V049-2-169	Rev.	0
--------	---	------------	------	---